


**Summit®**

BULKHEAD ASSEMBLY REPLACEMENT INSTRUCTIONS


**THIS PROCEDURE MUST BE PERFORMED BY AN AUTHORIZED
WEBER-STEPHEN PRODUCTS CO. SERVICE TECHNICIAN.
(ANY UNAUTHORIZED REPAIRS WILL VOID WARRANTY PROTECTION).**

⚠ WARNING: GENUINE WEBER-STEPHEN REPLACEMENT PARTS MUST BE USED FOR ANY REPAIR OR REPLACEMENT. YOUR ACTIONS, IF YOU FAIL TO FOLLOW THIS PRODUCT WARNING, MAY CAUSE A FIRE, AN EXPLOSION, OR STRUCTURAL FAILURE RESULTING IN SERIOUS PERSONAL INJURY OR DEATH AS WELL AS DAMAGE TO PROPERTY. (WILL VOID ALL WARRANTY PROTECTION.)

⚠ DANGER: BEFORE PERFORMING ANY WORK MAKE SURE THE GAS SUPPLY IS TURNED OFF AT THE SOURCE. FAILURE TO FOLLOW DANGERS, WARNINGS AND CAUTIONS CONTAINED IN THIS INSTRUCTION SHEET MAY CAUSE A FIRE OR AN EXPLOSION RESULTING IN SERIOUS PERSONAL INJURY OR DEATH AS WELL AS DAMAGE TO PROPERTY.

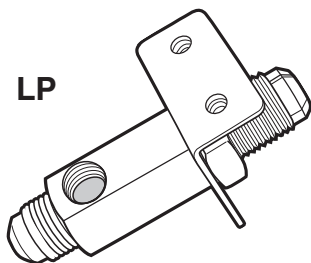LP

**SEE STEP #3:
LP BULKHEAD ASSEMBLY
REPLACEMENT**

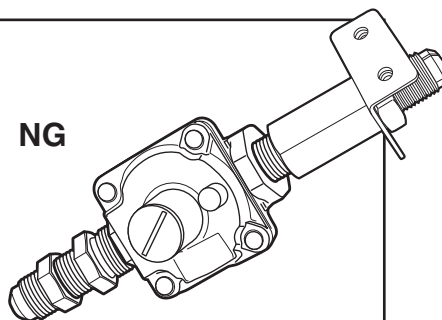NG

**SEE STEP #4:
NG BULKHEAD ASSEMBLY
REPLACEMENT**

1

REAR PANEL REMOVAL


⚠ BEFORE STARTING: Make sure the casters are locked to prevent the grill from moving while removing the cookbox assembly.

TOOLS NEEDED:



Rear Panel Removal:

- A)** Remove the four (4) nuts and washer securing the rear panel to the frame assembly with a 7/16" wrench or nutdriver.
- B)** Lift and remove the rear panel to the frame assembly.
- C)** Reinstall the two (2) top screws (1) into the frame assembly to stabilize the grill while you are working on the side burner gas line.

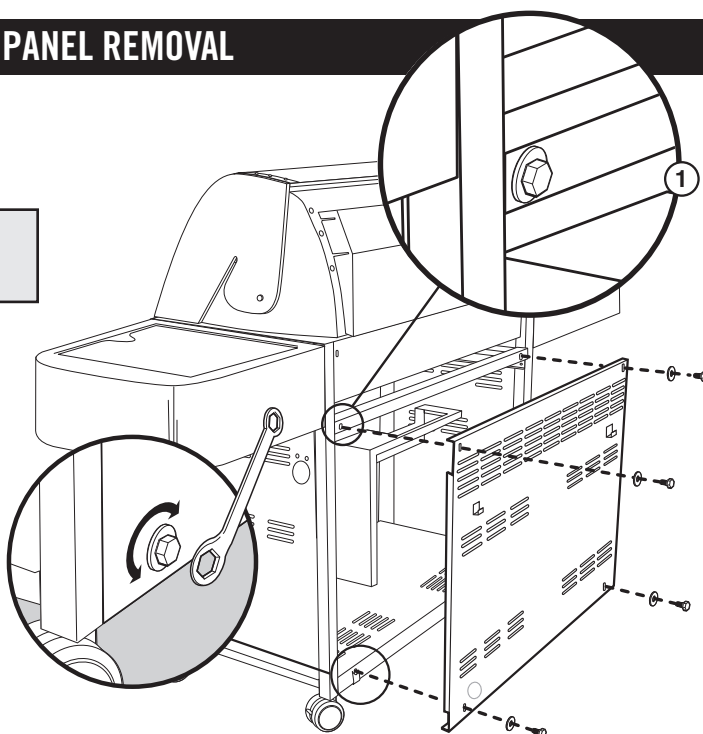

NOTE: The grills illustrated may have slight differences than the model purchased.

56292 03/24/08


DI

2 SIDE BURNER GAS LINE REMOVAL

TOOLS NEEDED:  - 7/16"

Gas Line to Bulkhead Removal:

- A) From the back of the grill, loosen and disconnect the side burner gas line from the bulkhead with a 7/16" wrench.

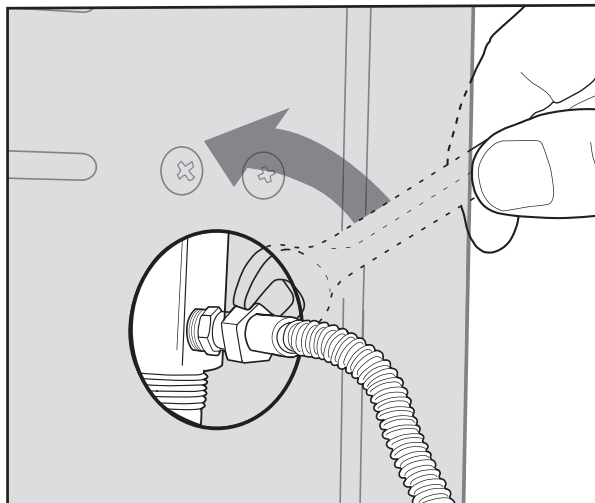


3 LP REGULATOR REMOVAL

TOOLS NEEDED:  - 3/4"
 - ADJUSTABLE WRENCH

STEP #1: REAR PANEL REMOVAL & STEP #2: SIDE BURNER GAS LINE REMOVAL MUST BE COMPLETED BEFORE ATTEMPTING THIS STEP.

LP Regulator Hose Removal:

- A) From the back of the grill, loosen and disconnect the regulator hose below the bulkhead with a 3/4" wrench and adjustable wrench.

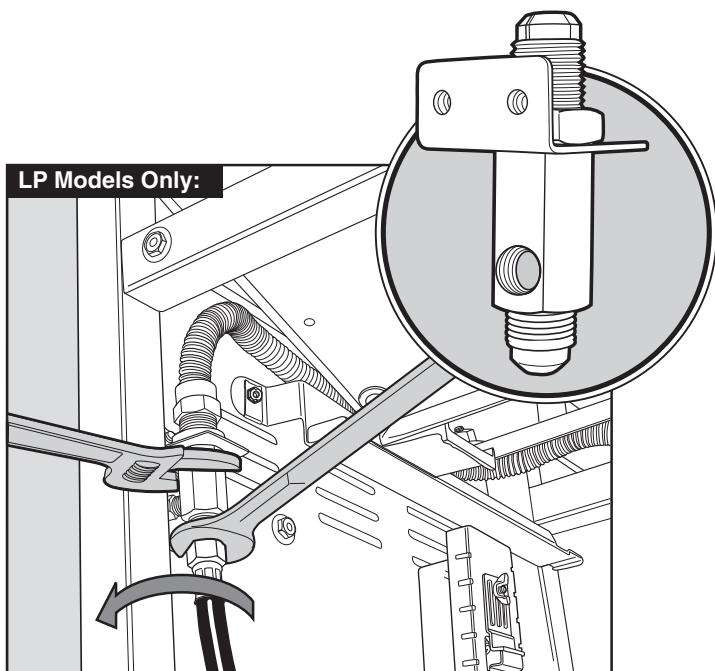


4 NG HOSE REMOVAL

TOOLS NEEDED:  - 3/4"
 - ADJUSTABLE WRENCH

STEP #1: REAR PANEL REMOVAL & STEP #2: SIDE BURNER GAS LINE REMOVAL MUST BE COMPLETED BEFORE ATTEMPTING THIS STEP.

Natural Gas Hose Removal:

- A) From the back of the grill, loosen and disconnect the regulator hose below the bulkhead with a 3/4" wrench and adjustable wrench.

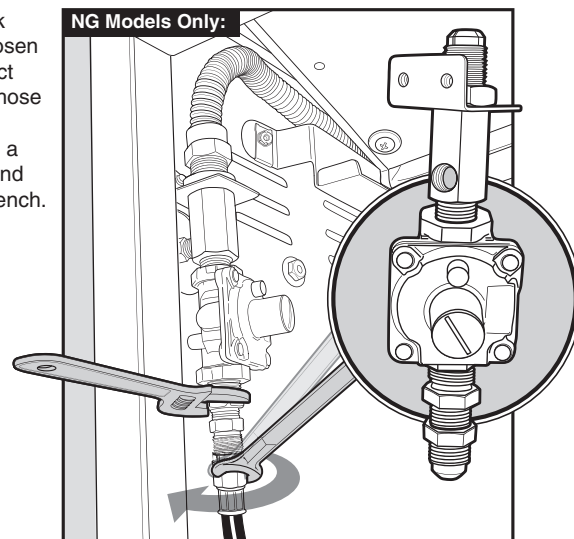


5 MAIN GAS LINE REMOVAL

TOOLS NEEDED:  - 7/8"
 - ADJUSTABLE WRENCH

Main Corrugated Gas Line from Bulkhead Removal:

- A) Remove the main gas line (1) connected to the top of the bulkhead, use one wrench to hold the bulkhead while using a second wrench to loosen the gas line from the bulkhead. (Use a 7/8" and adjustable wrench)

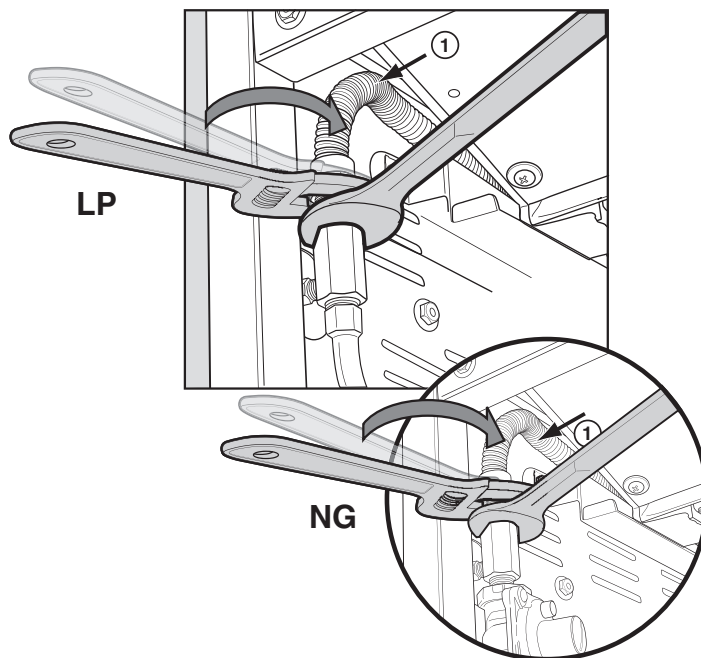


6

BULKHEAD BRACKET REMOVAL

LP or NG Bulkhead Removal:

- A) Remove the two (2) screws to release the bulkhead bracket from the grill frame. (Use a Phillips head screwdriver)

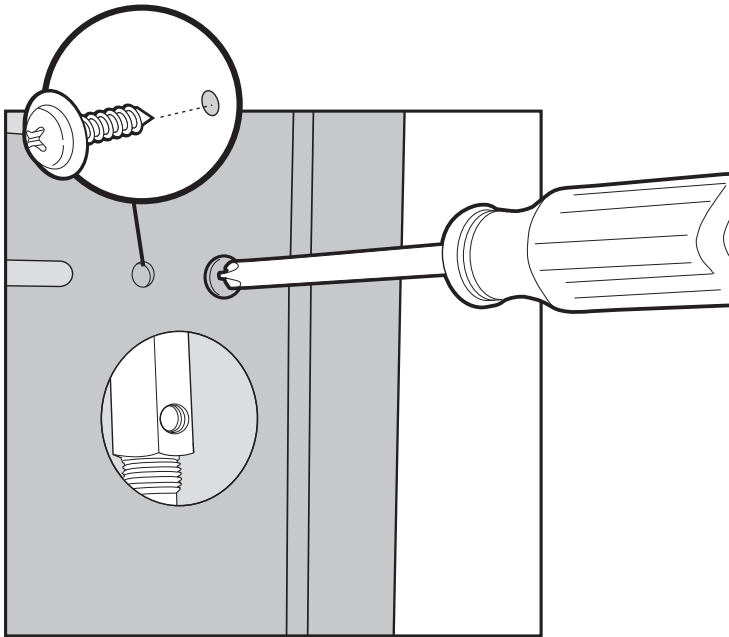

**INSTALL NEW LP OR NG BULKHEAD,
FOLLOW THIS REPLACEMENT SHEET
IN REVERSE ORDER FOR GRILL RE-ASSEMBLY.
THEN SEE STEP #7: CHECK FOR GAS LEAKS
BEFORE INSTALLING THE REAR PANEL.**

7

CHECK FOR GAS LEAKS

⚠ DANGER

Do not use an open flame to check for gas leaks. Be sure there are no sparks or open flames in the area while you check for leaks. Sparks or open flames will result in a fire or explosion, which can cause serious bodily injury or death and damage to property.

You will need: a soap and water solution and a rag or brush to apply it.

- A) Mix soap and water.
- B) Turn on the cylinder valve.
- C) Check for leaks by wetting the fitting with the soap and water solution and watching for bubbles. If bubbles form, or if a bubble grows, there is a leak.
- D) When leak checking is complete, turn gas supply off at the source and rinse connections with water.

Check:


- A) Quick-disconnect to gas line connection (1).
- B) Gas line to bulkhead connection (2).
- C) Bulkhead assembly (3).

⚠ **DANGER:** If there is a leak at connection (1, 2 or 3), retighten the fitting with a wrench and recheck for leaks with soap and water solution. If a leak persists, turn OFF the gas. **DO NOT OPERATE THE GRILL.** Failure to follow dangers, warnings and cautions contained in this Instruction sheet may cause a fire or an explosion resulting in serious personal injury or death as well as damage to property. Contact the Customer Service Representative in your area using the contact information on our web site. Log onto www.weber.com.

- D) Quick-disconnect to side burner connection (4).
- E) LP: Regulator connection (5).
- F) NG: Hose to quick-disconnect gas line connection (6).


⚠ **DANGER:** If there is a leak at connection (4, 5 or 6), turn off the gas. **DO NOT OPERATE THE GRILL.** Failure to follow dangers, warnings and cautions contained in this Instruction sheet may cause a fire or an explosion resulting in serious personal injury or death as well as damage to property. Contact the Customer Service Representative in your area using the contact information on our web site. Log onto www.weber.com.

When leak checks are complete, turn gas supply OFF at the source and rinse connections with water.

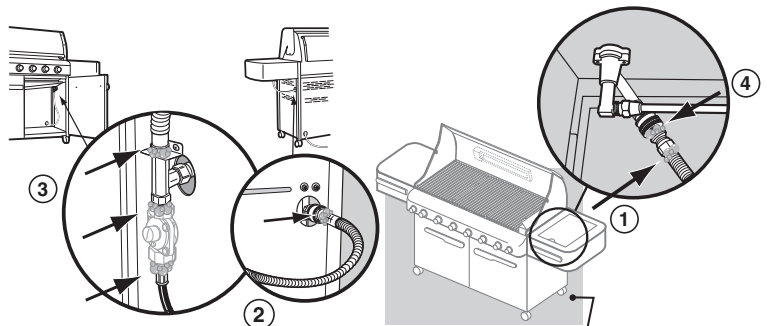


Gas Sources:

LP

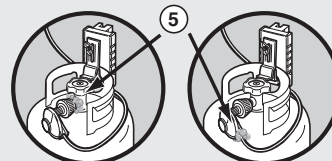

NG

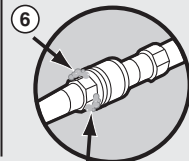

⚠ PROPOSITION 65 WARNING: HANDLING THE BRASS MATERIAL ON THIS PRODUCT EXPOSES YOU TO LEAD, A CHEMICAL KNOWN TO THE STATE OF CALIFORNIA TO CAUSE CANCER, BIRTH DEFECTS OR OTHER REPRODUCTIVE HARM.

(WASH HANDS AFTER HANDLING THIS PRODUCT.)

⚠ WARNING: All repairs to gas carrying, gas burning, igniter components or structural components must be performed by an authorized Weber-Stephen Products Co. service technician.

These parts may be gas carrying, gas burning components, igniter components or structural components. Please contact Weber-Stephen Products Co., Customer Service Department for Genuine Weber-Stephen Products Co. replacement part(s) information.

⚠ WARNING: Do not attempt to make any repair to gas carrying, gas burning, igniter components or structural components without contacting Weber-Stephen Products Co., Customer Service Department. Your actions, if you fail to follow this Product Warning, may cause a fire, an explosion, or structural failure resulting in serious personal injury or death as well as damage to property.



WEBER-STEPHEN PRODUCTS CO.
Customer Service Center
1890 Roselle Road, Suite 308
Schaumburg, IL 60195

1-800-446-1071 (USA ONLY)
www.weber.com